

Remove the plastic bessel below the lightswitch



Locate this black/blue 40 PIN connector



Connections of the CA-MAX01 YELLOW wire to pos. "C9" BLACK wire to pos. "C10" Connect long RED wire to ACC/Ignition 12/24v+ Connect long BLACK wire to ground After successful connection – the headunit must be coded for rearview camera activation – see described steps on next pages.

NOTE: This headunit only accepts NTSC format



1. Select the "App icon"



2. Select "System Settings"

System Settings



3. Select "System & Reset"



5A I.J 🜒 💲 8:01 AM

4. Select "System Information"



5. Touch the marked area with one finger for 5 sec.

System Version	REFRES Heart Select the stadilities have be assessed when a set > to well be define value, and						
Log Copy							
Bestern Frederic Cettings	Exterior color	Status Value:	<	勃朗白-暖白-单涂白色面漆	>	SAVE	
Restore Factory Settings	Tire pressure nonitoring system	Status Value:	<	TPMS (J17P) >		SAVE	
Offline Configuration	ane departure		<	LDWS (Q06A) >		SAVE	
Temp and Voltage Detection	autonomous emergency brakion		<	AEB SYSTEM >		SAVE	
Connection Status Detection	digital audio broadcasting		<	数字收音机 >		SAVE	
System Update			<	有前雷达 >		SAVE	
			<	有后曾达 >		SAVE	

7.Select "Offline Configuration"



6. Enter the password: s73p940a

<						
System Version	REFRES Note: Galace the monthlast term to represent cases < end > to served the state value, and					
Log Copy						
Restore Factory Settings	front radar	Status Value:	<	有前雷达 >	SAVE	
	behinds_radar	Status Value:	<	有后雷达 >	SAVE	
Offline Configuration	front radar count		<	前4个雷达 >	SAVE	
Temp and Voltage Detection	behinds radar count		<	后4个雷达 >	SAVE	
Connection Status Detection	vision 360	Status Value:	<	后视+动静态辅助线 >	SAVE	
System Update	speaker	Status Value:	<	2个扬声器 (U102) >	SAVE	
			<	окнz >	SAVE	

8. Scroll down and select "Vision 360"

9. In the "Vision 360" column – the Status Value are as described below





"Rear view camera + Dynamic & Static guidelines"

System Version	REFRES					
.og Copy	this disk the lines in to the control click at noncourse	Main the space the result for 10 secondities () scalus value,		unite, effectuate à sell salarm		
Restore Factory Settings	behinds_radar	Status Value:	<	有后雷达 >	SAVE	
Offline Configuration	front radar co			前4个雷达 >	SAVE	
Temp and Voltage	behinds radar	惨叹成切!!!		后4个雷达 >	SAVE	
Connection Status	vision 360	Status Value:	<	后视+无辅助线 >	SAVE	
Detection	speaker	Status Value:	<	2个扬声器 (U102) >	SAVE	
System Update			<	9кнz >	SAVE	

10. When selection have been made, choose "SAVE"

in the Slove Autor month value after autor ds_radar	to appendix 10 10 appendix 10 Status value. Status Value:	- <	value, effective & voli mico 1919年20 - 有后雷达 >	SAVE
ds_radar	Status Value:	<	有后雷达 >	SAVE
ader count	Status Value:	<	前4个雷达 >	SAVE
ds radar count		<	后4个雷达 >	SAVE
1 360	Status Value:	<	后视+无辅助线 >	SAVE
ker	Status Value :	<	2个杨声器 (U102) >	SAVE
		<	9кнz >	SAVE
	is radar count 360 er frequency am	Is radar count Status Value: 360 Status Value: er Status Value: frequency am Status Value:	ia radar count Status Value: 360 Status Value: er Status Value: frequency am Status Value:	is radar count Status Value: < 后4个面这 > 360 Status Value: < 后视+无辅助线 > er Status Value: < 2个扬声器 (J102) > frequency am Status Value: < 9KHZ >

11. Select "Back arrow"

System Set	tings		FM 87.5 lia	4 0 8	18:45
Bluetooth	System				
Sound	System Information				>
General	Disclaimer				>
System & Reset	Reset Reset System Settin	09		(77	
		95			
٨	63		C.	8	

12. New selections will only take affect after the headunit have been reset. To do this, select "Reset" in the System & Reset menu



13. Select "OK" – then headunit will reboot. This takes aprox 1 min.